


**RECALL PROCEDURE IN SHOP
TITAN 124606 DIN SCREW REPLACEMENT**

We were recently informed about the breakage under pressure of a TITAN DIN screw weakened during service by manual torque loads superior to the recommended values.



Aqualung asks all the owners of TITAN DIN whose serial number is lower than 6062501 and/or whose DIN screw is marked **300 BAR MAX** to return their regulator to their Aqualung approved retailer for an upgrade.

It is the replacement of the brass DIN screw by another stainless steel DIN screw marked **300 BAR MAXI**.

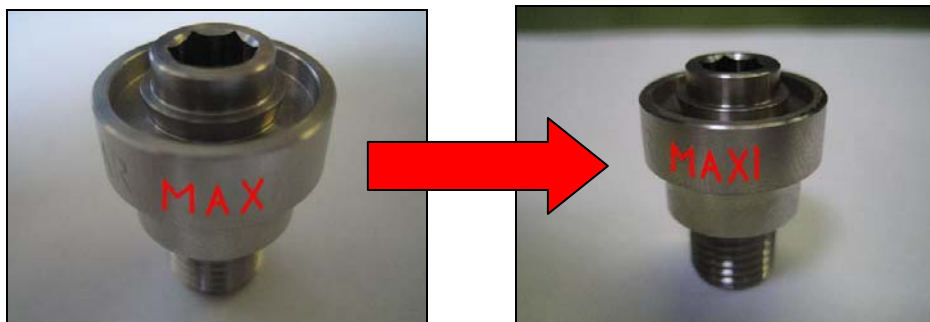

This replacement is made under warranty.

NB: all the regulators TITAN DIN whose serial number is superior to 6062501 and/or whose DIN screw is marked **300 BAR MAXI** are assembled with a stainless steel DIN screw and are not concerned by this recall in shop.